

# 3-Pin Microcontroller Reset Monitors


### **Features**

- Precision V<sub>DD</sub> Monitor for 2.5V, 3.0V, 3.3V, 5.0V Nominal System Voltage Supplies
- · 140 msec Minimum RESET Timeout Period
- RESET Output to V<sub>DD</sub> = 1.0V (TCM809)
- Low Supply Current, 9 μA (typ.)
- V<sub>DD</sub> Transient Immunity
- · Small 3-Pin SC-70 and SOT-23B Packages
- · No External Components
- · Push-pull RESET output
- · Temperature Range:
  - Commercial, SC-70(E): -40°C to +85°C
  - Industrial, SOT-23, SC-70(V): -40°C to +125°C

# **Applications**

- · Computers
- · Embedded Systems
- · Battery Powered Equipment
- · Critical Microcontroller Power Supply Monitoring
- Automotive

# **Typical Application Circuit**

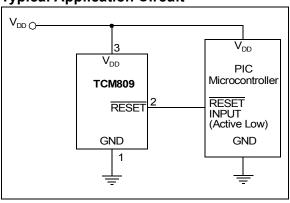


### **General Description**

The TCM809 and TCM810 are cost effective system supervisor circuits designed to monitor  $V_{DD}$  in digital systems and provide a reset signal to the host processor when necessary. No external components are required.

The RESET output is typically driven active within 20 µsec (SOT-23) or 65 µsec (SC-70) of  $V_{DD}$  falling through the reset voltage threshold. RESET is maintained active for a minimum of 140 msec after  $V_{DD}$  rises above the reset threshold. The TCM810 has an active-high RESET output while the TCM809 has an active-low RESET output. The output of the TCM809/ TCM810 is valid down to  $V_{DD}$  = 1V. Both devices are available in 3-Pin SOT-23B and SC-70 packages.

The TCM809/TCM810 are optimized to reject fast transient glitches on the  $V_{DD}$  line. Low supply current of 9  $\mu$ A (typ.,  $V_{DD}$  = 3.3V) makes these devices suitable for battery powered applications.

# **Pin Configurations**

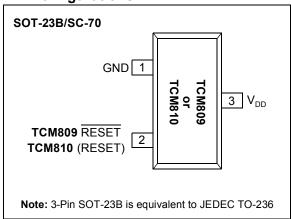

#### 1.0 **ELECTRICAL CHARACTERISTICS**

# **ABSOLUTE MAXIMUM RATINGS\***

Supply Voltage (V <sub>DD</sub> to GND)	6.0V
RESET, RESET	$-0.3V$ to $(V_{DD} + 0.3V)$
Input Current, V <sub>DD</sub>	20 mA
Output Current, RESET, RESET	20 mA
dV/dt (V <sub>DD</sub> )	100V/µsec
Operating Temperature Range	40°C to +125°C
Power Dissipation (T <sub>A</sub> = 70°C):	
3-Pin SOT-23B (derate 4 mW/°C abov	re +70°C)320 mW
3-Pin SC-70 (derate 2.17 mW/°C above	/e +70°C)174 mW
Storage Temperature Range	65°C to +150°C
Maximum Junction Temperature, T <sub>J</sub>	150°C

<sup>\*</sup>Notice: Stresses above those listed under "Maximum ratings" may cause permanent damage to the device. This is a stress rating only and functional operation of the device at those or any other conditions above those indicated in the operational listings of this specification is not implied. Exposure to maximum rating conditions for extended periods may affect device reliability.

# **PIN FUNCTION TABLE**

NAME	FUNCTION		
GND	Ground		
RESET (TCM809)	RESET push-pull output remains low while V <sub>DD</sub> is below the reset voltage threshold and for 240 msec (140 msec min.) after V <sub>DD</sub> rises above reset threshold.		
RESET (TCM810)	RESET push-pull output remains high while V <sub>DD</sub> is below the reset voltage threshold and for 240 msec (140 msec min.) after V <sub>DD</sub> rises above reset threshold.		
$V_{DD}$	Supply voltage (+2.5V, +3.0V, +3.3V, +5.0V)		

# **ELECTRICAL CHARACTERISTICS**

 $V_{DD}$  = Full Range,  $T_A$  = Operating Temperature Range, unless otherwise noted. Typical values are at  $T_A$  = +25°C,  $V_{DD}$  = 5V for L/M/J, 3.3V for T/S, 3.0V for R, and 2.5V for Z (**Note 1**).

Parameter	Sym	Min	Тур	Max	Units	Test Conditions
V <sub>DD</sub> Range		1.0		5.5 5.5	V	$T_A = 0^{\circ}C \text{ to } +70^{\circ}C$ $T_A = -40^{\circ}C \text{ to } +125^{\circ}C$
Supply Current (SOT-23)	I <sub>CC</sub>		24 17	60 50	μA	TCM8xxL/M: $V_{DD}$ < 5.5V TCM8xxR/S/T/Z: $V_{DD}$ < 3.6V
Supply Current (SC-70)	I <sub>CC</sub>	_	12 9	30 25	μA	TCM8xxL/M/J: V <sub>DD</sub> < 5.5V TCM8xxR/S/T/Z: V <sub>DD</sub> < 3.6V
Reset Threshold (Note 2)	$V_{TH}$	4.56 4.50	4.63 —	4.70 4.75	٧	TCM8xxL: $T_A = +25^{\circ}C$ $T_A = -40^{\circ}C$ to +125°C
		4.31 4.25	4.38 —	4.45 4.50		TCM8xxM: $T_A = +25^{\circ}C$ $T_A = -40^{\circ}C$ to +125°C
		3.93 3.89	4.00 —	4.06 4.10		TCM809J: $T_A = +25^{\circ}C$ $T_A = -40^{\circ}C$ to +125°C
		3.04 3.00	3.08	3.11 3.15		TCM8xxT: $T_A = +25^{\circ}C$ $T_A = -40^{\circ}C$ to +125°C
		2.89 2.85	2.93 —	2.96 3.00		TCM8xxS: $T_A = +25^{\circ}C$ $T_A = -40^{\circ}C$ to +125°C
		2.59 2.55	2.63 —	2.66 2.70		TCM8xxR: $T_A = +25^{\circ}C$ $T_A = -40^{\circ}C$ to +125°C
		2.28 2.25	2.32 —	2.35 2.38		TCM8xxZ: $T_A = +25^{\circ}C$ $T_A = -40^{\circ}C$ to +125°C
Reset Threshold Tempco		_	30	_	ppm/°C	
V <sub>DD</sub> to Reset Delay, SOT-23		_	20	_	μsec	$V_{DD} = V_{TH}$ to $(V_{TH} - 100 \text{ mV})$ (Note 2)
V <sub>DD</sub> to Reset Delay, SC-70		_	65	_	µsec	$V_{DD} = V_{TH}$ to $(V_{TH} - 100 \text{ mV})$ (Note 2)
Reset Active Time-out Period, SOT-23		140	240	560	msec	
Reset Active Time-out Period, SC-70	-	140	320	560	msec	
RESET Output Voltage Low (TCM809)	V <sub>OL</sub>	_ _ _		0.3 0.4 0.3	V	TCM809R/S/T/Z: $V_{DD} = V_{TH}$ min, $I_{SINK} = 1.2$ mA TCM809L/M/J: $V_{DD} = V_{TH}$ min, $I_{SINK} = 3.2$ mA $V_{DD} > 1.0V$ , $I_{SINK} = 50$ $\mu$ A
RESET Output Voltage High (TCM809)	V <sub>OH</sub>	0.8 V <sub>DD</sub> V <sub>DD</sub> – 1.5			V	TCM809R/S/T/Z: $V_{DD} > V_{TH}$ max, $I_{SOURCE}$ = 500 $\mu$ A TCM809L/M/J: $V_{DD} > V_{TH}$ max, $I_{SOURCE}$ = 800 $\mu$ A

Production testing done at  $T_A$  = +25°C, over temperature limits ensured by QC screen. RESET Output for TCM809, RESET Output for TCM810. Note

 $V_{DD}$  = Full Range,  $T_A$  = Operating Temperature Range, unless otherwise noted. Typical values are at  $T_A$  = +25°C,  $V_{DD}$  = 5V for L/M/J, 3.3V for T/S, 3.0V for R, and 2.5V for Z (**Note 1**).


Parameter	Sym	Min	Тур	Max	Units	Test Conditions
RESET Output Voltage Low (TCM810)	V <sub>OL</sub>	_	1 1	0.3 0.4	V	$ \begin{array}{ll} \text{TCM810R/S/T/Z: V}_{\text{DD}} = \text{V}_{\text{TH}} \text{ max, I}_{\text{SINK}} = 1.2 \text{ mA} \\ \text{TCM810L/M:} & \text{V}_{\text{DD}} = \text{V}_{\text{TH}} \text{ max, I}_{\text{SINK}} = 3.2 \text{ mA} \\ \end{array} $
RESET Output Voltage High (TCM810)	V <sub>OH</sub>	0.8 V <sub>DD</sub>	_	_	V	$1.8 < V_{DD} < V_{TH}$ min, $I_{SOURCE} = 150 \mu A$

 $\frac{\text{Production testing done at T}_{\text{A}} = +25^{\circ}\text{C}, \text{ over temperature limits ensured by QC screen.}}{\text{RESET Output for TCM809}, \text{RESET Output for TCM810}}.$ Note

# 2.0 APPLICATIONS INFORMATION

# 2.1 VDD Transient Rejection

The TCM809/TCM810 provides accurate  $V_{DD}$  monitoring and reset timing during power-up, power-down, and brownout/sag conditions. These devices also reject negative-going transients (glitches) on the power supply line. Figure 2-1 shows the maximum transient duration vs. maximum negative excursion (overdrive) for glitch rejection. Any combination of duration and overdrive which lies under the curve will not generate a reset signal.

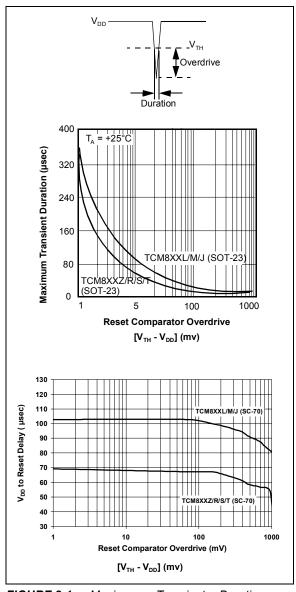


**FIGURE 2-1:** Maximum Transient Duration vs. Overdrive for Glitch Rejection at 25°C.

Combinations above the curve are detected as a brownout or power-down condition. Transient immunity can be improved by adding a capacitor in close proximity to the  $V_{DD}$  pin of the TCM809/TCM810.

# 2.2 <u>RESET Signal Integrity During</u> Power-Down


The TCM809  $\overline{\text{RESET}}$  output is valid to  $V_{DD}$  = 1.0V. Below this voltage the output becomes an "open circuit" and does not sink current. This means CMOS logic inputs to the microcontroller will be floating at an undetermined voltage. Most digital systems are completely shutdown well above this voltage. However, in situations where RESET must be maintained valid to V<sub>DD</sub> = 0V, a pull-down resistor must be connected from RESET to ground to discharge stray capacitances and hold the output low (Figure 2-2). This resistor value, though not critical, should be chosen such that it does not appreciably load RESET under normal operation (100  $k\Omega$  will be suitable for most applications). Similarly, a pull-up resistor to  $V_{\mbox{\scriptsize DD}}$  is required for the TCM810 to ensure a valid high RESET for V<sub>DD</sub> below 1.0V.

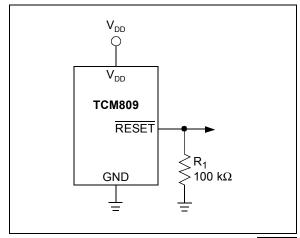

**FIGURE 2-2:** The addition of  $R_1$  at the RESET output of the TCM809 ensures that the RESET output is valid to  $V_{DD} = 0V$ .

# 2.3 <u>Controllers and Processors With</u> Bidirectional I/O Pins


Some microcontrollers have bi-directional reset pins. Depending on the current drive capability of the controller pin, an indeterminate logic level may result if there is a logic conflict. This can be avoided by adding a 4.7 k $\Omega$  resistor in series with the output of the TCM809/ TCM810 (Figure 2-3). If there are other components in the system which require a reset signal, they should be buffered so as not to load the reset line. If the other components are required to follow the reset I/O of the microcontroller, the buffer should be connected as shown with the solid line.

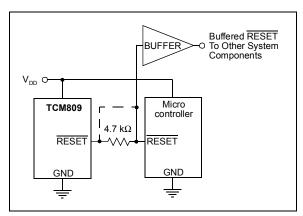


**FIGURE 2-3:** Interfacing the TCM809 to a Bidirectional RESET I/O.

# 3.0 TYPICAL PERFORMANCE CHARACTERISTICS


**Note:** The graphs and tables provided following this note are a statistical summary based on a limited number of samples and are provided for informational purposes only. The performance characteristics listed herein are not tested or guaranteed. In some graphs or tables, the data presented may be outside the specified operating range (e.g., outside specified power supply range) and therefore outside the warranted range.

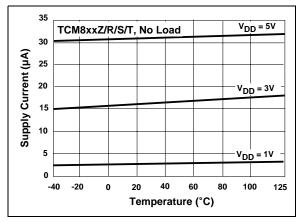


**FIGURE 3-1:** Supply Current vs. Temperature, SOT-23.

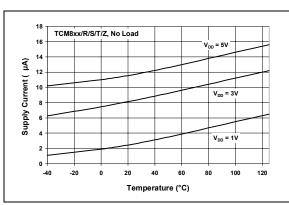


**FIGURE 3-2:** Supply Current vs. Temperature, SC-70.

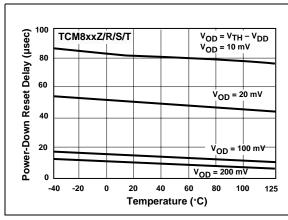


**FIGURE 3-3:** Power-Down Reset Delay vs. Temperature, SOT-23.

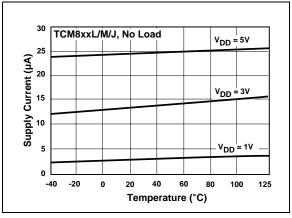


**FIGURE 3-4:** Supply Current vs. Temperature, SOT-23.

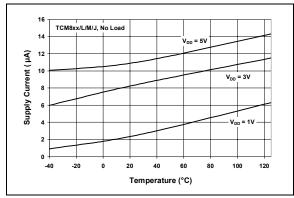


**FIGURE 3-5:** Supply Current vs. Temperature, SC-70.

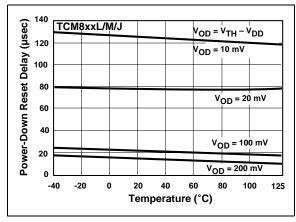


**FIGURE 3-6:** Power-Down Reset Delay vs. Temperature, SOT-23.

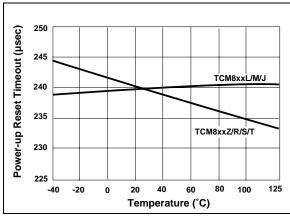


**FIGURE 3-7:** Power-Up Reset Time-out vs. Temperature, SOT-23.

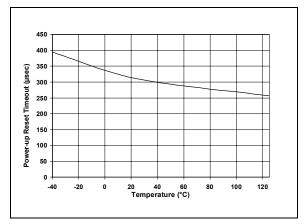

**FIGURE 3-8:** Power-up Reset Time-out vs. Temperature, SC-70.

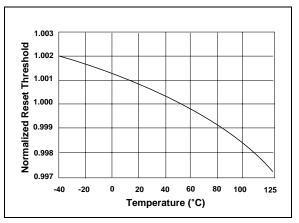


**FIGURE 3-9:** Normalized Reset Threshold vs. Temperature, SOT-23.

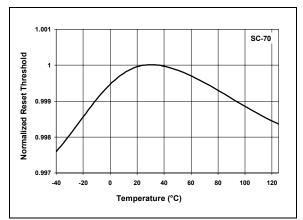

**FIGURE 3-10:** Normalized Reset Threshold vs. Temperature, SC-70.


# 4.0 PACKAGING INFORMATION

# 4.1 Package Marking Information

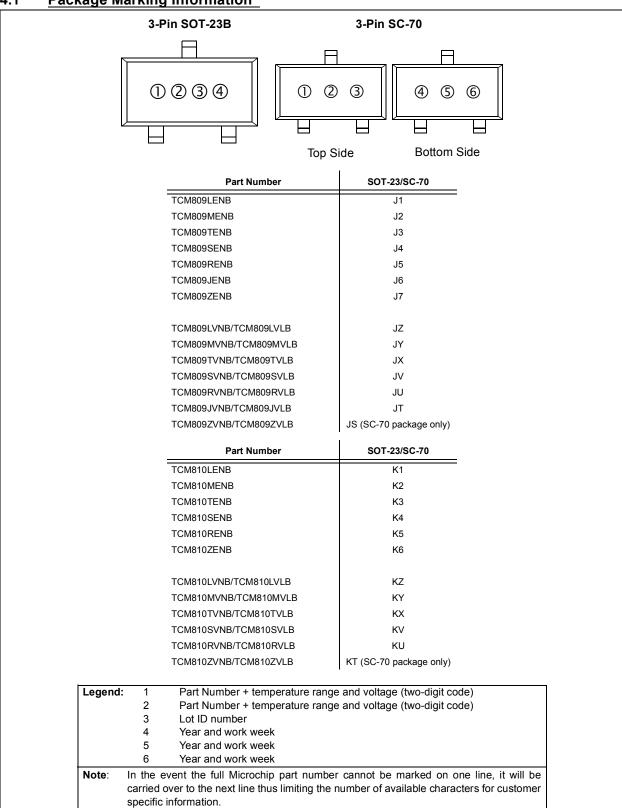

# 4.2 Taping Form



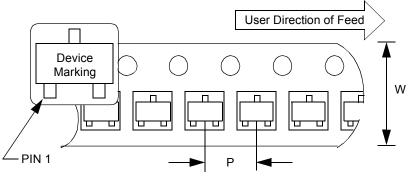


Standard Reel Component Orientation for 713 Suffix Device (Mark Right Side Up)

### Carrier Tape, Number of Components Per Reel and Reel Size:

Package	Carrier Width (W)	Pitch (P)	Part Per Full Reel	Reel Size
3-Pin SOT-23B	8 mm	4 mm	3000	7 in.

# Component Taping Orientation for 3-Pin SC-70 (EIAJ) Devices

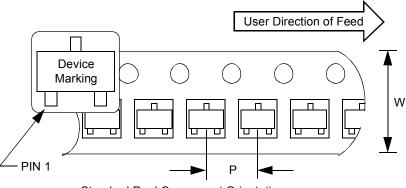


Standard Reel Component Orientation for 713 Suffix Device (Mark Right Side Up)

# Carrier Tape, Number of Components Per Reel and Reel Size:

Package	Carrier Width (W)	Pitch (P)	Part Per Full Reel	Reel Size
3-Pin SC-70	8 mm	4 mm	3000	7 in.

# 4.3 Packaging Information

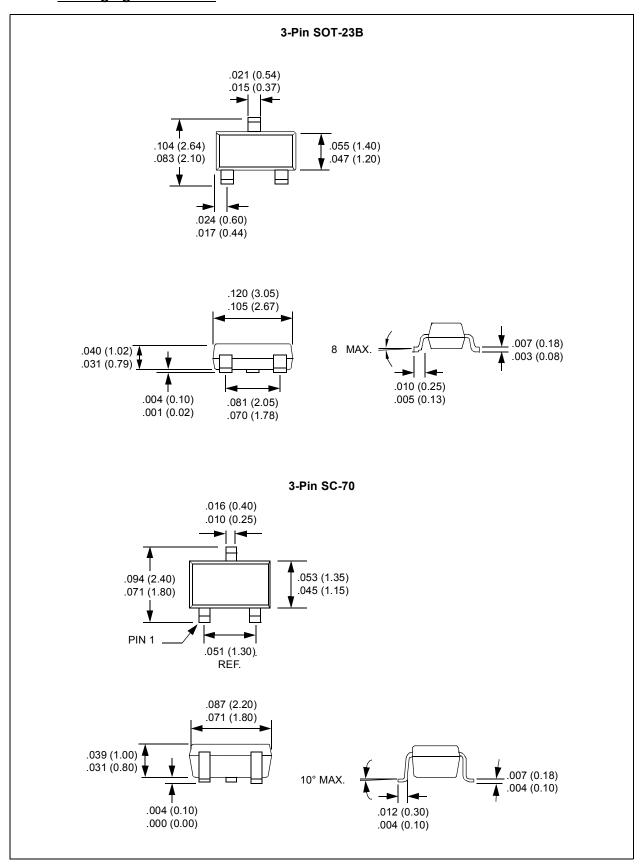

# **ON-LINE SUPPORT**

Microchip provides on-line support on the Microchip World Wide Web (WWW) site.

The web site is used by Microchip as a means to make files and information easily available to customers. To view the site, the user must have access to the Internet and a web browser, such as Netscape or Microsoft Explorer. Files are also available for FTP download from our FTP site.

# Connecting to the Microchip Internet Web Site

The Microchip web site is available by using your favorite Internet browser to attach to:

#### www.microchip.com

The file transfer site is available by using an FTP service to connect to:

#### ftp://ftp.microchip.com

The web site and file transfer site provide a variety of services. Users may download files for the latest Development Tools, Data Sheets, Application Notes, User's Guides, Articles and Sample Programs. A variety of Microchip specific business information is also available, including listings of Microchip sales offices, distributors and factory representatives. Other data available for consideration is:

- · Latest Microchip Press Releases
- Technical Support Section with Frequently Asked Questions
- · Design Tips
- · Device Errata
- Job Postings
- · Microchip Consultant Program Member Listing
- Links to other useful web sites related to Microchip Products
- Conferences for products, Development Systems, technical information and more
- · Listing of seminars and events

## **Systems Information and Upgrade Hot Line**

The Systems Information and Upgrade Line provides system users a listing of the latest versions of all of Microchip's development systems software products. Plus, this line provides information on how customers can receive any currently available upgrade kits. The Hot Line Numbers are:

1-800-755-2345 for U.S. and most of Canada, and 1-480-792-7302 for the rest of the world.

013001

# **READER RESPONSE**

It is our intention to provide you with the best documentation possible to ensure successful use of your Microchip product. If you wish to provide your comments on organization, clarity, subject matter, and ways in which our documentation can better serve you, please FAX your comments to the Technical Publications Manager at (480) 792-4150.

Please list the following information, and use this outline to provide us with your comments about this Data Sheet.

To:	Technical Publications Manager	Total Pages Sent
RE:	Reader Response	
Fror	m: Name	
۸nn	Telephone: () olication (optional):	
	uld you like a reply?YN	
		N 1
Dev	vice: TCM809/TCM810 Literature	Number: <b>DS21661B</b>
Que	estions:	
1.	What are the best features of this documen	t?
2.	How does this document meet your hardwa	re and software development needs?
3.	Do you find the organization of this data she	eet easy to follow? If not, why?
4.	What additions to the data sheet do you thin	nk would enhance the structure and subject?
5.	What deletions from the data sheet could be	e made without affecting the overall usefulness?
6.	Is there any incorrect or misleading informa	tion (what and where)?
7.	How would you improve this document?	
8.	How would you improve our software, syste	ems, and silicon products?

# PRODUCT IDENTIFICATION SYSTEM

To order or obtain information, e.g., on pricing or delivery, refer to the factory or the listed sales office.

PART NO.	X T	<u> </u>	xxxxx
	V <sub>DD</sub> Reset reshold	Temperature Range	Package
Device:			n active-low RESET output n active-high RESET output
V <sub>DD</sub> Reset Threshold:	L = 4. M = 4. J = 4. T = 3. S = 2. R = 2. Z = 2.	.38V .00V .08V .93V .63V	
Temperature Range:		10°C to +85°C 10°C to +125°C	
Package:		SOT-23B, 3-pin (Tape SC-70, 3-pin (Tape a	

### Examples:

- TCM809LENB713: SOT-23B-3-TR, Microcontroller 4.63V Reset Monitor, -40°C to +85°C, Tape and Reel.
- TCM809LVLB713: SC-70-3-TR, Microcontroller 4.63V Reset Monitor, -40°C to +125°C, Tape and Reel.
- TCM809LVNB713: SOT-23B-3-TR, Microcontroller 4.63V Reset Monitor, -40°C to +125°C, Tape and Reel.
- TCM810MENB713: SOT-23B-3-TR, Microcontroller 2.63V Reset Monitor, -40°C to +85°C, Tape and Reel.
- TCM810RVLB713: SOT-23B-3-TR, Microcontroller 2.63V Reset Monitor, -40°C to +125°C, Tape and Reel.
- TCM810TVLB713: SC-70-3-TR, Microcontroller 2.63V Reset Monitor, -40°C to +125°C, Tape and Reel.

# **Sales and Support**

# Data Sheets

Products supported by a preliminary Data Sheet may have an errata sheet describing minor operational differences and recommended workarounds. To determine if an errata sheet exists for a particular device, please contact one of the following:

- 1. Your local Microchip sales office
- 2. The Microchip Corporate Literature Center U.S. FAX: (480) 792-7277
- 3. The Microchip Worldwide Site (www.microchip.com)

Please specify which device, revision of silicon and Data Sheet (include Literature #) you are using.

#### **New Customer Notification System**

Register on our web site (www.microchip.com/cn) to receive the most current information on our products.

NOTES:

Information contained in this publication regarding device applications and the like is intended through suggestion only and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. No representation or warranty is given and no liability is assumed by Microchip Technology Incorporated with respect to the accuracy or use of such information, or infringement of patents or other intellectual property rights arising from such use or otherwise. Use of Microchip's products as critical components in life support systems is not authorized except with express written approval by Microchip. No licenses are conveyed, implicitly or otherwise, under any intellectual property rights.

#### **Trademarks**


The Microchip name and logo, the Microchip logo, FilterLab, KEELOQ, MPLAB, PIC, PICmicro, PICMASTER, PICSTART, PRO MATE, SEEVAL and The Embedded Control Solutions Company are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

dsPIC, ECONOMONITOR, FanSense, FlexROM, fuzzyLAB, In-Circuit Serial Programming, ICSP, ICEPIC, microID, microPort, Migratable Memory, MPASM, MPLIB, MPLINK, MPSIM, MXDEV, PICC, PICDEM, PICDEM.net, rfPIC, Select Mode and Total Endurance are trademarks of Microchip Technology Incorporated in the U.S.A.

Serialized Quick Term Programming (SQTP) is a service mark of Microchip Technology Incorporated in the U.S.A.

All other trademarks mentioned herein are property of their respective companies.

© 2002, Microchip Technology Incorporated, Printed in the U.S.A., All Rights Reserved.

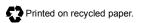



Microchip received QS-9000 quality system certification for its worldwide headquarters, design and wafer fabrication facilities in Chandler and Tempe, Arizona in July 1999. The Company's quality system processes and procedures are QS-9000 compliant for its PICmicro® 8-bit MCUs, KEELOQ® code hopping devices, Serial EEPROMs and microperipheral products. In addition, Microchip's quality system for the design and manufacture of development systems is ISO 9001 certified.



# WORLDWIDE SALES AND SERVICE

#### **AMERICAS**

### **Corporate Office**

2355 West Chandler Blvd. Chandler, AZ 85224-6199 Tel: 480-792-7200 Fax: 480-792-7277 Technical Support: 480-792-7627 Web Address: http://www.microchip.com

#### **Rocky Mountain**

2355 West Chandler Blvd. Chandler, AZ 85224-6199 Tel: 480-792-7966 Fax: 480-792-7456

#### Atlanta

500 Sugar Mill Road, Suite 200B Atlanta, GA 30350

Tel: 770-640-0034 Fax: 770-640-0307

#### **Boston**

2 Lan Drive, Suite 120 Westford, MA 01886 Tel: 978-692-3848 Fax: 978-692-3821

Chicago

333 Pierce Road, Suite 180

Itasca, IL 60143 Tel: 630-285-0071 Fax: 630-285-0075

#### **Dallas**

4570 Westgrove Drive, Suite 160 Addison, TX 75001 Tel: 972-818-7423 Fax: 972-818-2924

#### Detroit

Tri-Atria Office Building 32255 Northwestern Highway, Suite 190 Farmington Hills, MI 48334 Tel: 248-538-2250 Fax: 248-538-2260

### Kokomo

2767 S. Albright Road Kokomo, Indiana 46902 Tel: 765-864-8360 Fax: 765-864-8387

#### Los Angeles

18201 Von Karman, Suite 1090 Irvine, CA 92612

Tel: 949-263-1888 Fax: 949-263-1338

### **New York**

150 Motor Parkway, Suite 202 Hauppauge, NY 11788 Tel: 631-273-5305 Fax: 631-273-5335

## San Jose

Microchip Technology Inc. 2107 North First Street, Suite 590 San Jose, CA 95131 Tel: 408-436-7950 Fax: 408-436-7955

#### Toronto

6285 Northam Drive, Suite 108 Mississauga, Ontario L4V 1X5, Canada Tel: 905-673-0699 Fax: 905-673-6509

#### ASIA/PACIFIC

#### Australia

Microchip Technology Australia Pty Ltd Suite 22, 41 Rawson Street Epping 2121, NSW Australia

Tel: 61-2-9868-6733 Fax: 61-2-9868-6755

#### China - Beijing Microchip Technology Consulting (Shanghai)

Co., Ltd., Beijing Liaison Office Bei Hai Wan Tai Bldg.

No. 6 Chaoyangmen Beidajie Beijing, 100027, No. China Tel: 86-10-85282100 Fax: 86-10-85282104

#### China - Chengdu

Microchip Technology Consulting (Shanghai) Co., Ltd., Chengdu Liaison Office Rm. 2401, 24th Floor, Ming Xing Financial Tower No. 88 TIDU Street Chengdu 610016, China Tel: 86-28-6766200 Fax: 86-28-6766599

#### China - Fuzhou

Microchip Technology Consulting (Shanghai) Co., Ltd., Fuzhou Liaison Office Unit 28F, World Trade Plaza No. 71 Wusi Road Fuzhou 350001, China Tel: 86-591-7503506 Fax: 86-591-7503521

### China - Shanghai

Microchip Technology Consulting (Shanghai) Co., Ltd. Room 701, Bldg. B Far East International Plaza No. 317 Xian Xia Road

Shanghai, 200051 Tel: 86-21-6275-5700 Fax: 86-21-6275-5060

### China - Shenzhen

Microchip Technology Consulting (Shanghai) Co., Ltd., Shenzhen Liaison Office Rm. 1315, 13/F, Shenzhen Kerry Centre, Renminnan Lu

Shenzhen 518001, China Tel: 86-755-2350361 Fax: 86-755-2366086

## **Hong Kong**

Microchip Technology Hongkong Ltd. Unit 901-6, Tower 2, Metroplaza 223 Hing Fong Road Kwai Fong, N.T., Hong Kong Tel: 852-2401-1200 Fax: 852-2401-3431

#### India

Microchip Technology Inc. India Liaison Office Divvasree Chambers 1 Floor, Wing A (A3/A4) No. 11, O'Shaugnessey Road Bangalore, 560 025, India Tel: 91-80-2290061 Fax: 91-80-2290062

#### Japan

Microchip Technology Japan K.K. Benex S-1 6F 3-18-20, Shinyokohama Kohoku-Ku, Yokohama-shi Kanagawa, 222-0033, Japan Tel: 81-45-471-6166 Fax: 81-45-471-6122

#### Korea

Microchip Technology Korea 168-1, Youngbo Bldg. 3 Floor Samsung-Dong, Kangnam-Ku Seoul, Korea 135-882

Tel: 82-2-554-7200 Fax: 82-2-558-5934

### Singapore

Microchip Technology Singapore Pte Ltd. 200 Middle Road #07-02 Prime Centre Singapore, 188980 Tel: 65-334-8870 Fax: 65-334-8850

Taiwan

Microchip Technology Taiwan 11F-3, No. 207 Tung Hua North Road Taipei, 105, Taiwan

Tel: 886-2-2717-7175 Fax: 886-2-2545-0139

#### **EUROPE**

#### Denmark

Microchip Technology Nordic ApS Regus Business Centre Lautrup hoj 1-3 Ballerup DK-2750 Denmark Tel: 45 4420 9895 Fax: 45 4420 9910

#### France

Microchip Technology SARL Parc d'Activite du Moulin de Massy 43 Rue du Saule Trapu Batiment A - Ier Etage 91300 Massy, France Tel: 33-1-69-53-63-20 Fax: 33-1-69-30-90-79

**Germany** Microchip Technology GmbH Gustav-Heinemann Ring 125 D-81739 Munich, Germany Tel: 49-89-627-144 0 Fax: 49-89-627-144-44

# Italy

Microchip Technology SRL Centro Direzionale Colleoni Palazzo Taurus 1 V. Le Colleoni 1 20041 Agrate Brianza Milan, Italy
Tel: 39-039-65791-1 Fax: 39-039-6899883

# **United Kinadom**

Arizona Microchip Technology Ltd. 505 Eskdale Road Winnersh Triangle Wokingham Berkshire, England RG41 5TU Tel: 44 118 921 5869 Fax: 44-118 921-5820

01/18/02

